



DUO-THERM "505" PRESSURE TESTABLE JOINT CLOSURE INSTRUCTIONS

FKII
14.901

DUO-THERM "505" PRESSURE TESTABLE JOINT CLOSURE W/ ERM

12.17.10

INSTALLATION PROCEDURE FOR PRESSURE TESTABLE JOINT CLOSURES WITH ERM FOR DUO-THERM PIPING SYSTEM

Materials & Equipment

MATERIALS:

1. Sectional Insulation
2. (2) 1/2" Stainless Steel Bands (for insulation)
3. Split Conduit Sleeve
4. Thermacor Pressure Testable Joint Closure Sleeve
5. Pour Foam, Components "A" & "B"
6. 3 Wooden Tongue Depressors (Per Kit)
7. 2 Frictional Weld Plugs (Per Kit)
8. ERM Jumper Cable (Per Kit)
9. 1 H.S Sleeve & Patch

EQUIPMENT PROVIDED BY THERMACOR ON 30 DAY LOAN:

1. 110V Electric Power Control Unit w/ Adjustable Output (0-20 amps)
2. 4 Rubber Bands, each 4" Wide (per power unit requested)
3. Air Gauge Test Assembly

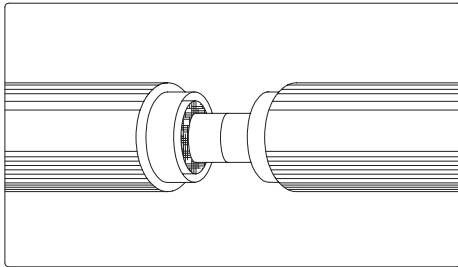
4. Ratchet Strap Tools

5. 1 Frictional Welding Drill Bit (per power unit requested)
6. Analog Ohmmeter

EQUIPMENT PROVIDED BY CONTRACTOR:

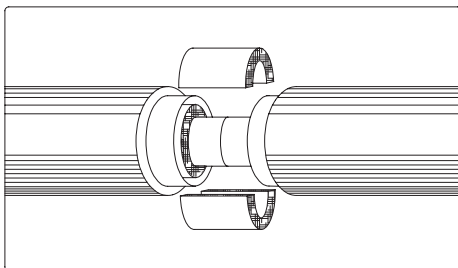
1. Hand Air Pump or Compressor
2. Clean Rags
3. Duct Tape
4. Hole Saw, 1" Hole Cutter
5. 5/8" Side Grinder
6. Safety Equipment as Prescribed by local Regulations
7. Tape Measure
8. Soap & Water Bottle
9. Propane Torch
10. Crimpers

Step 1.



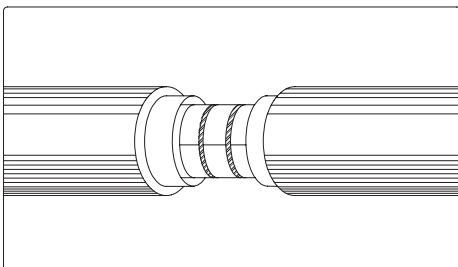
Carefully cut and remove shipping straps from carrier pipe and conduit. Factory recommends use of a grinder to remove straps. **DO NOT CUT OR GOUGE PIPE WHEN REMOVING STRAPS.** Weld carrier pipes together at joint. After weld has cooled, hydro-test as per specifications.

Step 2.



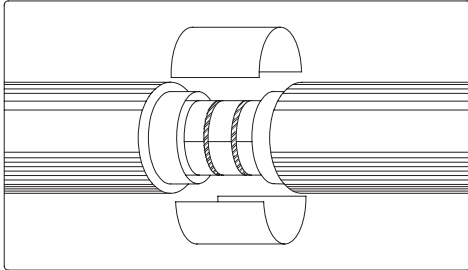
After pipe pressure test, insulate the joint using sectional insulation.

Step 3.



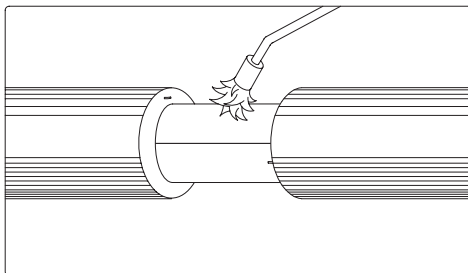
Secure insulation in place using (2) 1/2" stainless steel bands.

IMPORTANT: THE JOINT AND JOINT MATERIALS MUST BE KEPT DRY!!

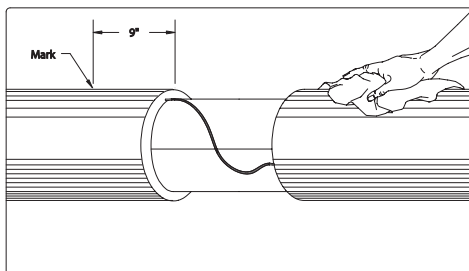
Step 4.


ONLY LABORERS TRAINED AND CERTIFIED BY THERMACOR ARE ALLOWED TO PERFORM THIS INSTALLATION. A Site foreman or inspector is required to inspect and log each joint on attached form. **Failure to provide this documentation will void Thermacor's warranty.**

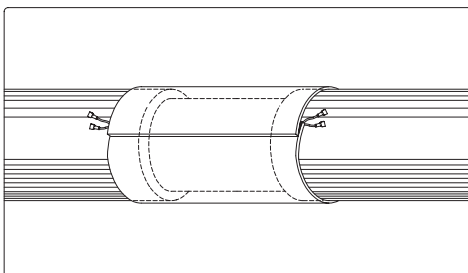
Place split conduit sleeve over joint and weld in place. After weld has cooled, pressure test as per specifications.

Step 5.


Use a propane torch with a light, billowy flame to dry the area out, regardless whether or not the area appears dry. Residual moisture may be present that is not readily seen.

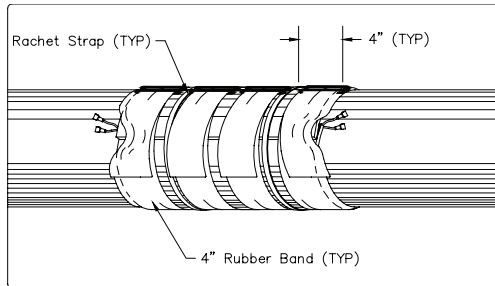
Step 6.


Following the ERM leak detection instructions, test the continuity of the pipe. Trim the bare copper wire so that it cannot make contact with the carrier pipe. Connect one end of the insulated jumper cable and crimp. Complete the connection to the second wire and crimp. Test the connection by following the ERM instructions. Make sure that the ERM jumper cable is **NOT** centered on the top of the joint, but placed to one side to prevent damaging the wire when drilling the air test hole. Clean HDPE jacket and wrap around sleeve with rag to remove any dust or dirt. Center the sleeve over the weld joint. Mark each end of PTJC on the HDPE jacket. On top of the jacket, make a mark 9" from the cutback on each side to locate pour holes.

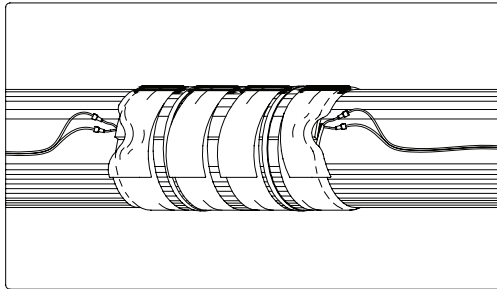
Step 7.


Wrap the Thermacor Pressure Testable Joint Closure (PTC) Sleeve **tightly** over insulated joint with longitudinal seam at 2 O'Clock position. Joint should overlap 2 to 4 inches and shall be centered over the joint. The Electro-Fusion Rod imbedded in the sleeve should be in tight contact with the clean jacket and longitudinal overlap. After the sleeve is wrapped around the joint, make sure the ends are square to each other at the overlap area. Hold in place with 1" ratchet straps. (Note: If overlap is greater than 4" or less than 2", contact Thermacor for instructions.)

IMPORTANT: THE JOINT AND JOINT MATERIALS MUST BE KEPT DRY!!

Step 8.


Tighten 1" Ratchet Straps to sleeve to ensure even pressure is maintained on fusion surfaces. **NO GAPS SHOULD BE VISIBLE.** Stretch 2 of the 4 inch "Rubber Bands", provided by Thermacor, along the edge of the sleeve. **Rubber bands need to be at the edge of the sleeve.** Stretch one 4 inch "Rubber Band" around the middle of the HDPE sleeve. The rubber bands should be placed at the 11 O'Clock position with "This End Up" visible. The loose end of the rubber band is threaded through the buckle and the rubber band is pulled tight in the **SAME DIRECTION** as the overlap. On each end of the sleeve, insert the wooden shims in between the rubber band and where the wire exits the sleeve. Gently pull the wires 90 degrees from the overlap, taking care not to pull wires off sleeve

Step 9.


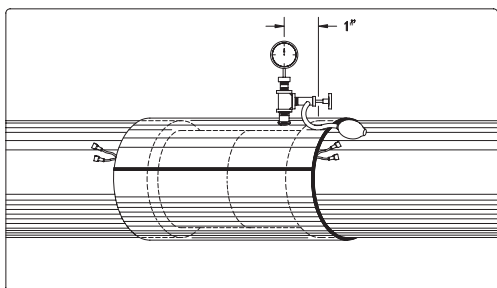
Connect 110V single phase welding machine to a **DEDICATED POWER SOURCE.** Attach power cables extending from a 110V single phase welding machine to the Electro-Fusion wire. (Note: It does not matter which color power cable is connected to the Electro-Fusion wire). Apply 12 +/-0.5 Amps to the sleeve. **Maintain 12 Amps throughout the heating cycle.** Check the Amp reading after 5 minutes of heating to ensure that the reading remains at 12 Amps. Do not exceed 12 Amps. See power chart for heating times. Heating times will vary. **NOTE: JOINT IS NOT COMPLETE UNTIL MELT IS VISIBLE EXTRUDING FROM ALL CIRCUMFERENTIAL SEAMS.** As the heating cycle proceeds, the rubber bands exert constant pressure on the sleeve. **DO NOT RETIGHTEN THE RATCHET STRAPS ONCE HEATING CYCLE HAS BEGUN.** The automatic timer is set for the correct heating time, shutting off the power at the end of the cycle. Allow power cords to cool for 5 minutes before disconnecting. Remove power cords and allow to cool for a minimum of 15 minutes or until the weld zone is the same temperature as the adjacent jacket. **Do not remove the straps or rubber bands until the joint has cooled!**

*Heating times increase with cold weather. Insulation blanket may be required around PTC during severe cold. Fusion complete when HDPE melt is seen oozing from all seams and wire indentation is seen (see pictures from submittal package).

POWER CHART		
JACKET SIZE	AMPS	*MINUTES
5" TO 14"	12	20 – 30
16" TO 24"	12	25 – 35
26" TO 30"	12	30 – 40
30" AND UP	12	40 – 50

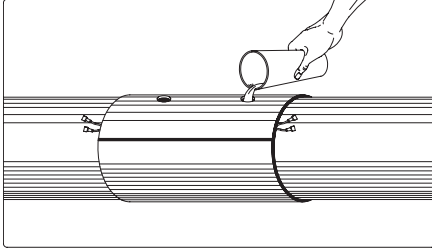
NOTE: Power requirement is 12 amps ± 0.5

Ambient temperature affects cook times. The adjacent chart shows cook times with an assumed ambient temperature of 75°F. Cooler days require longer cooking time as with warm days require minimum time shown on chart. **The joint cooking process is only complete after visible HDPE melt is seen oozing from all seams and wire indentation is seen** (see pictures from submittal package).

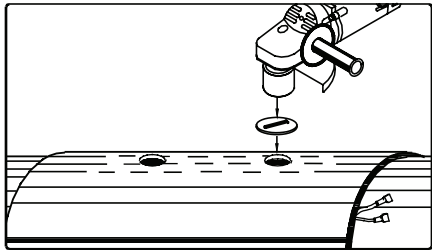
Step 10.


Measure 10" from the 9" mark and drill a 1" hole in the sleeve at 12 O'Clock. Push the Pressure Gauge and Valve Test Device into the hole. Using hand pump or other air supply obtain 5 psi pressure. Disconnect air supply and soap joint for "pin hole" leaks. Hold air pressure for 5 minutes. (Note: In rare cases air will escape down the interface between the foam and the jacket. This can be confirmed by soaping the end of the jacket interface).

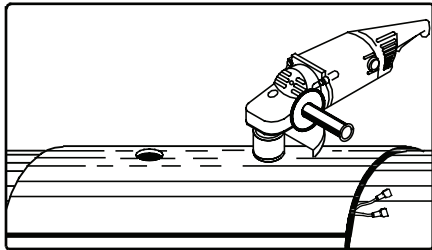
IMPORTANT: THE JOINT AND JOINT MATERIALS MUST BE KEPT DRY!!

Step 11.


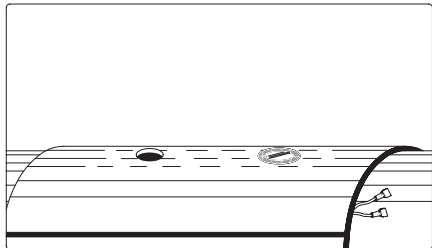
Remove test apparatus. Drill a second 1" hole 10" from the 9" mark at 12 O' Clock. Mix required foam per Foam Kit Instructions and pour into 1" hole. Allow foam and gas (Air) to escape through holes, cover the holes with duct tape when the foam comes out of the holes. See Foam Kit Instructions for quantities, etc.

Step 12.


Clean any excess foam off the HDPE jacket. Using a chisel or other device, remove the foam from each hole to below the lip of the HDPE. Install drill bit provided by Thermacor into 5/8" side grinder. Fit the raised tongue of the white plug into the groove in the drill bit. Center the raised circle on the plug into the hole in the HDPE jacket.

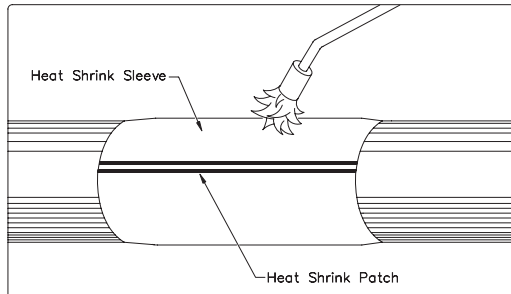
Step 13.


Apply firm downward pressure on the plug, then spin the plug at full speed until outside of drill bit touches HDPE jacket (approx. 13 seconds). Stop spinning the plug, but continue applying downward pressure. At the same time, tilt the grinder slightly, approximately 5 degrees, moving the grinder so that pressure is applied on all sides of the plug. Maintain the downward pressure for another 20 seconds.

Step 14.


Visually inspect the plug after the fusing process. The edge of the clear plug should have turned black around the outer 1/2" if a good bond has been made. If the edges are not black, carefully drill the plug out (re-drill the existing hole) and repeat the process.

IMPORTANT: THE JOINT AND JOINT MATERIALS MUST BE KEPT DRY!!

Step 15.

Crimp off the Electro- Fusion wires at the PTC sleeve. Using a soft billowy flame, heat the patch with a smooth brushing motion until it becomes soft and shiny. Remove heat and press the patch to the sleeve with a gloved hand to form a bond. Heat the rest of the heat shrink sleeve into place, starting at the bottom center of the sleeve and working up and out toward the ends. The mastic should be visible on both sides after the sleeve has cooled.

INSTALLER IS REQUIRED TO SIGN THEIR NAME AND DATE ON THE JOINT WITH A YELLOW PAINT PEN.

IMPORTANT: THE JOINT AND JOINT MATERIALS MUST BE KEPT DRY!!



DUO-THERM "505" PRESSURE TESTABLE JOINT CLOSURE INSTRUCTIONS

FKII
14.906

DUO-THERM "505" PRESSURE TESTABLE JOINT CLOSURE W/ ERM

12.17.10

STANDARD POUR FOAM MIXING QUANTITIES

Conduit Size (in)	HDPE Jacket (in)	Foam Thickness	HDPE Sleeve	"A" Component (fl. oz)	"B" Component (fl. oz)
6 5/8	9.0	1"	30"W x 14"	10	10
8 5/8	11.0	1"	30"W x 14"	13	13
10 3/4	13.2	1"	30"W x 14"	16	16
12 3/4	15.2	1"	30"W x 20"	19	19
14	16.4	1"	30"W x 20"	20	20
16	18.5	1"	30"W x 20"	23	23
18	20.5	1"	30"W x 24"	26	26
20	22.5	1"	30"W x 24"	29	29
22	24.5	1"	30"W x 30"	31	31
24	26.5	1"	30"W x 30"	34	34
26	28.5	1"	30"W x 30"	37	37
28	30.5	1"	(2) 30"W x 20"	39	39
30	32.5	1"	(2) 30"W x 20"	42	42
32	34.5	1"	(2) 30"W x 20"	44	44
34	36.5	1"	(2) 30"W x 20"	47	47
36	38.5	1"	(2) 30"W x 24"	50	50

*Contact Thermacor for pour foam amounts where foam insulation thickness is greater than 1".

IMPORTANT: THE JOINT AND JOINT MATERIALS MUST BE KEPT DRY!!